# WQ0217 **Panel Mounted kwh Meters**




## **FEATURES:**

- Energy meter, Class 1 (EN 61036)
- Single phase or three phase connection
- 7 -digit cyclometer register
- Microprocessor control
- Exchangeable scale
- Relay outputs
- Standard 96 x 96 mm DIN case
- Protective cover for terminals (optional)



Picture 1: Panel Mounted kwh Meters WQ0217

# **OPERATION**

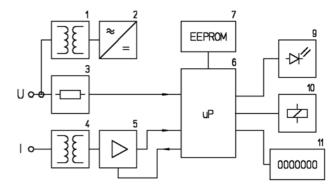

Picture 2: Block diagram

- 1. Power supply
- transformer 2. Rectifier

- transformers
- 5. Current autorange
- 6. Microprocessor
- 7. EEPROM
- 3. Voltage divider
- 4. Current measuring
- 9. Relay outputs
- 10. Register

A sampling method of voltages and currents with A/D converter is used in the instrument. Voltages are connected via a voltage divider (3). Currents are electrically isolated with current measuring transformers (4). A built-in microprocessor (6) calculates rms currents, rms voltages and active power at the end of a period from sample values of voltages and currents. Other quantities (apparent power, reactive power, power factor) are calculated from these values. A microprocessor with a quartz crystal assures exact calculation of energy from power.

Data of the instrument version (transformer ratios, connection type, etc.) are stored in EEPROM (7), therefore the instrument can be programmed without opening.

## **APPLICATION**

WQ0217 meters are intended for energy measurement in single phase or three phase systems, class 1 (EN 61036). They are built into a standard 96x96 mm DIN case. The meter is microprocessor controlled. Energy is displayed with 7-digit electromechanical register which retains the value also in case of auxiliary power supply failure. The instrument can be adapted to the applied current measuring transformers.

Single phase and three phase meters with optionally built in relay output are designed to send data directly to microprocessor based equipment which can be programmed to control and save energy. Meters with relay outputs are suitable for a wide range of applications including: energy management systems, maximum demand recorders, etc.

## **CONSTRUCTION**

#### CASE

The casing is made of a black self-extinguished material with highly resistance to creep currents. The instrument front side is protected with a glass.

### **CONNECTION TERMINALS**

At the instrument rear side are connection terminals. A connection part is divided into two parts. The upper part is intended for connection of single phase or three phase measuring system, and the lower part for connection of options (auxiliary supply and/or relay outputs). A connection diagram is on the instrument.

#### **ENERGY DISPLAY**

The electromechanical register consists of seven black segments. Numbers are white. They are 4 mm high and 1.2 mm wide.

Besides the data on the instrument version the calibration constants are stored in EEPROM. There are no setting components (trimmers) in the instrument which assures better long-term stability. A built-in current autorange (5) assures accuracy also in case of small currents. High sampling rate enables measurement of distorted signals.

Basic version of the instrument is provided with one electromechanical register (10).

Two relay outputs (9) can be built in the instrument.

The frequency of the relay varies according to the energy consumed.

Instrument auxiliary power supply can be provided from the measuring system or separately (option). Power supply of the instrument is performed via a supply transformer (1) and a rectifier (2).

## **TECHNICAL DATA**

#### ACCURACY CLASS:

<ul> <li>Energy</li> </ul>
----------------------------

EN 61036 class 1

50 In 1s

## **VOLTAGE INPUT:**

• Standard rated voltages (Un) 57, 100	0, 230, 400 V AC		
Optional rated voltage	50 to 400 V AC		
Voltage measuring range			
extemal auxiliary supply	01.5 Un		
supply from a measuring system	0.81.2 Un		
Self consumption of voltage input			
extemal auxillary supply	< 0.1 VA		
supply from a measuring system	< 3.0 VA		
Rated frequency	50, 60 Hz		
Frequency range	45 to 65 Hz		
• Overload at external auxiliary supply	2 Un, 10 s		
CURRENT INPUT:			
• Rated current (In)	1A or 5 A		
• Maximal current (Imax)	1.6 In		
• Self-consumption of current input	< 0.1 VA		
• Overloads 3 In permanently			
- •	25 In 3s		

#### **AUXILIARY SUPPLY (OPTION):**

•	Standard auxiliary	
	voltages (Uaux)	57, 100, 230, 400 V AC
•	Optional auxiliary voltages	50 400 V AC
•	Supply voltage range	0.8 1.2 Uaux
•	Consumption	< 3 AV
	Overload	2 Uaux, 1 s

## **ELECTROMECHANICAL REGISTER:**

- Number of digits 7
  - Size of digits 4 x 1 .2 mm

#### **RELAY OUTPUT:**

Relay 250 V, 6 A, 50 Hz
Maximum switching power 1500 VA
Standard number of relays Relay duration 100 ms

#### **DESIGN:**

•


•	Case	plastic, in compliance with UL 94 V-0
•	Protection	IP 52 (IP 00 for terminals)
		(IP 20 with protective cover)
•	Safety	in compliance with EN 61010-1
	600 V	Installation category <b>II</b>
		Pollution degree 2
	300 V	Installation category III
		Pollution degree 2
•	Weight	0.6 kg
A	MBIENT CONDI	TIONS JVF (DIN 40 040)
•	Temperature:	


EN	ЛС		
•	Humidity	up to 95% (without	condensing)
	Storing		- 40 to 70°C
	Rated range of operation	n	- 10 to 60°C
	Reference range of operation		0 to 50°C
•	Temperature:		


• RFI (H	Radiated)	EN 61000-4-3	<b>3</b> ,10 V/m
• EFT (	Burst)	EN 61000-4-4, leve	14,4 kV
• ESD (	Electrostatic dischar	ge) EN 61000-4	<b>I-2</b> , 8 kV

## CONNECTION

The instrument connection can be, regarding the version, either single phase or three-phase, its load can be balanced or unbalanced, its measuring system can be performed either in 3 or 4-wire connection. Instrument power supply can be provided from the measuring system (self powered) via input terminals or with auxiliary supply (option).

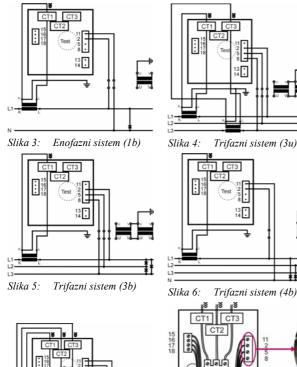

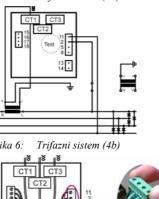



Slika 8: Priključitev opcij

Slika 7: Trifazni sistem (4u)

#### **DATA FOR ORDERING:**

When ordering the instrument it is necessary to state its type, connection, voltage and current transformer ratio, rated input voltage, rated input current and additional options.

Basic data:

WQ0217 - bb, cccc/ddd V, eeee/f A, gg Hz, Rh, Eiii V

- bb 1 b - single phase connection
  - 3b 3 phase, 3-wire connection with balance load
  - 3u 3 phase, 3-wire connection with unbalance load
  - 4b 3 phase, 4-wire connection with balance load
  - 4u 3 phase, 4-wire connection with unbalance load
- cccc/ primary voltage of a measuring transformer
- ddd V rated voltage (57, 100,230,400 V)
- primary current of a measuring transformer eeee/
- fA rated current (1, 5 A)

gg Hz rated frequency (50, 60 Hz)

- number of relay outputs (0, 1, 2)h
- AC external power supply (57 100, 230, 400) iii

Additional data for register and relay output:

ab cd, eeee relays/ffff

- C register а
- R relay
- register or relay number (1, 2)b
- A active energy meter с
  - R reactive energy meter
- I import energy meter d E - export energy meter
- number of relays for energy unit eeee
- ffff energy unit (kWh (kvarh), MWh (Mvarh))

#### **EXAMPLE FOR ORDERING**


Basic data for energy meter in 3 phase 4-wire system with unbalance load, with 10,000/100 V VT, with 100/5 CT, 50 Hz frequency, with one relay output and with 230 V external auxiliary supply are:

WQ0217- 4u, 10k/100 V, 100/5 A, 50 Hz, R1, E230 V

Additional data for register and one relay output for active energy with 100 relays per MWh are:

C1 AI, 100 relays/MWh R1 AI, 100 relays/MWh

#### **DIMENSIONAL DRAWING:**

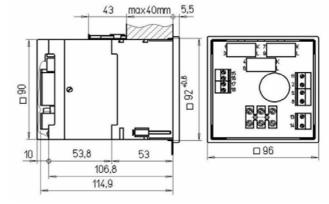

Picture 3: Dimensional drawing (all dimensions are in mm)



Ljubljanska c. 24a SI-4000 Kranj Slovenia tel.: +386 4 237 21 40 fax: +386 4 237 21 29 e-mail: info@iskra-mis.si www.iskra-mis.si





Printed in Slovenia • Subject to change without notice • Version 02 / Nov. 2005 • E P22.431.200